Works Number	Watercourse Name	Location	Date for Re- Inspection*	Description of Works
	South Kessock			
580	Seawall	3 Areas in the seawall	25/02/2025	Repair missing stones sets in the seawall
	Dingwall Flood			
608	Defences	Canal footpath At victoria park	14/01/2025	Infill and seal holes in the embankment where rabbits have been burrowing.
626	Mill Burn	Culvert under Sir Walter Scott Drive	03/03/2025	Remove all silt and stone deposation from the inlet and ditch 10m upstream from the inlet
		Next to the playing ground at Grebe Avenue		
633	Druid Temple Burn	Hall	03/03/2025	Remove all vegetation lying in and across the burn which is restricting forward flow of water
		Adjacent to the Distributor Road (B8082) behind		remove silt accumulations from the culvert inlet which has reduced the culvert width by approx 5
635	Ault na Skiah	properties on Castle Heather Avenue	03/03/2025	growing in the burn or on the burn sides.
636	SWFRC	SWRFC numerous locations	07/04/2025	Remove all vegetation gorse/whin are growing on the crown and sides of the flood relief channe
				Silt accumulations and a build up of debris/rubbish at the culvert, some of which is lying at the tw
658	Slackbuie Channel	Junction of Culduthel Road and Green Drive	03/03/2025	possible and ensure inlets are clear.
				The culvert outlet is 50% surcharged due to windblown trees and woody debris lying across the
664	Ault na Skiah	Culvert outlet opposite Evan Barron Rd	03/03/2025	down to the boundary fence of the property. Clear all woody debris from the open section.
		Near Passing Place Lay-by next to Brahan		Heavy Vegetation surrounding Inlet & all along Bank Upstream to Structure 60 & Downstream to
690	Ben View Burn	View, Upper Arcan Road Marybank.	03/02/2025	from Inlet of S70 & all along Downstream between S70 & S72.
724	Knockbain Burn	Knockbain Burn, near Gorstan, Dingwall	26/12/2024	Build up of Silt on LHS near Screen - Should be cleared
		Underneath Bridge on B862, near Holm Lodge.		
738	Holm Burn	Inverness	03/03/2025	Tree Limb stuck underneath Bridge on B862. Limb will need to be removed.
				Stone/ Concrete Culvert Pipe has collasped causing Water to back up and overflow down towar
739	Swordale Burn	Bonar Bridge	21/01/2025	responsibility of the Homeowner to undergo the Works required.
				Partial blockage and likely collapse of stone culvert within 2m of Manhole. Section is estimated
741	Park Burn	Park Road,Sstrathpeffer	25/02/2025	blockage removed.
743	Guisach Burn	Treasures of the Earth Museum	21/12/2024	Screen blinded by sediment. BEAR contacted to clear the screen.
744	Mill Burn	Section between Mason Road & Teal Avenue	03/03/2025	Fallen Trees lying within the Watercourse accumulating Derbis. Trees & Debris to be removed t
		Along section of Burn that runs parallel with		Fallen Tree lying within the Watercourse accumulating Derbis upstream from Culvert Inlet, Tree
747	Clyne Burn	Clynelish Road & the back of Brora Distillery	16/12/2024	flow.
		Culvert under single track road near Am Bothan,		
748	Gergask Burn	Laggan	12/02/2025	Culvert Inlet blocked with Wooden debris & Large Tree Branch, should be removed to ensure u
	Ŭ	Screened Inlet to Culvert under Station Road		Inlet area silted up which has raised the bed of the watercourse, silting the Screen Inlet by appro
749	Eil Burn	(A862), Conon Bridge	30/01/2025	Inlet.
751	Culloden Burn West	Outlet of Culvert, next to Gruffalo carving	12/03/2025	Burn blocked with cluster of Woody debris, should be cleared to ensure un-restricted flow
753	Allt Mhallaig	Ceol na Mara, Melvich	17/02/2025	Vegetation surrounding the Inlet & Outlet areas of the Culvert needs to be removed. Section 18
<u> </u>		Within Farm field east of St Trothan's Church,		Multiple fallen trees & concrete slabs lying within Burn D/S from Outlet, this should be cleared to
754	Olrig Cemetery Burn	Olrig Cemetery, Castletown	17/02/2025	issued
757	Allt a Mhinisteir	Road leading into Dores Parish Church, Dores	24/01/2025	Washed down Stones within Culvert & Inlet/ Outlet areas. Stones should be removed & burn dit
758	Culloden Burn West	Ferntower Avenue	15/08/2029	Jetting required to clear debris in culvert.

* The stated date for re-inspection denotes when the re-inspection is due and not when the works are due to be carried out

x 50%, please remove any self seeded trees that are

nel. Currently growing is numerous areas twin culvert inlets, please remove as much silt as

he watercourse for the majority of the open section

to S72. Vegetation to be cut back 10m Upstream

vards the Property. Homeowners property, it is the

ed to be below footpath. Callapse to be repaired and

d to ensure un-restricted flow.

ree & Debris to be removed to ensure un-restricted

e un-restricted flow

prox. 50%. Silt should be removed surrounding the

18 letter issued.

to ensure un-restricted waterflow. Section 18 letter

ditched.